



210-344-1344 S.A.
713-923-2133 Houston
512-804-2637 Austin
888-390-5692 Toll Free
mgessner@amerispec.net
www.amerispec.net/gessner

PROPERTY INSPECTION REPORT

Prepared For: Tony Scarnato
(Name of Client)

Concerning: 1514 Villa Flores San Antonio, TX 78237
(Address or Other Identification of Inspected Property)

By: Gary Armstrong 9604 09/12/07
(Name and License Number of Inspector) (Date)

(Name, License Number and Signature of Sponsoring Inspector, if required)

The inspection of the property listed above must be performed in compliance with the rules of the Texas Real Estate Commission (TREC).

The inspection is of conditions which are present and visible at the time of the inspection, and all of the equipment is operated in normal modes. The inspector must indicate which items are in need of repair or are not functioning and will report on all applicable items required by TREC rules.

This report is intended to provide you with information concerning the condition of the property at the time of inspection. Please read this report carefully. If any item is unclear, you should request the inspector to provide clarification.

It is recommended that you obtain as much history as is available concerning this property. This historical information may include copies of any seller's disclosures, previous inspection or engineering reports, reports performed for or by relocation companies, municipal inspection departments, lenders, insurers, and appraisers. You should attempt to determine whether repairs, renovation, remodeling, additions or other such activities have taken place at this property.

Property conditions change with time and use. Since this report is provided for the specific benefit of the client(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

ADDITIONAL INFORMATION PROVIDED BY INSPECTOR

Report Number: 20070839905 Phone Number: _____
Date of Inspection: 09/12/07 Fax Number: _____
Time of Inspection: 3:00pm
Client Mailing Address: _____
City/State/Zip: _____

SPECIAL NOTES:

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair.

I=Inspected	NI=Not Inspected	NP=Not Present	R=Not Functioning or In Need of Repair	Inspection Item
I	NI	NP	R	

I. STRUCTURAL SYSTEMS

- A. Foundations** (if all crawl space areas are not inspected, provide an explanation.)
Comments (An opinion on performance is mandatory.):
 FOUNDATION TYPE- Concrete slab on grade.
 CONCRETE FOUNDATION OBSERVATIONS- Foundation appears to be functioning normally at time of inspection.
 Minor signs of past settlement observed in the form of hair line type cracking to finished surfaces at front porch, at garage floor areas, at front porch area.

- B. Grading and Drainage**
Comments
 Structure is built on a slightly sloped lot. Grade at foundation appears inadequate at left areas. Repair drainage at these areas to properly drain away from foundation, to prevent water accumulation and possible stress to structure.
 Soil installed too high to siding at front right of house. Lower soil properly below base of siding and maintain proper slope away from foundation.

- C. Roof Covering** (if the roof is inaccessible, report the method used to inspect.)
Comments
 METHOD USED TO INSPECT ROOF- The following was observed from either eave level and/or ground level using binoculars
 DESCRIPTION OF MATERIALS- Composition and/or fiberglass shingles. Note: Average life expectancy under normal installation/conditions is between 10 -14 years. Approximate age of roof. Approximate age of this roof covering is believed to be between 5 and 10 years old.
 ROOF COVERING OBSERVATIONS- Starter strip around perimeter edge of roof improperly installed, not sealed down as per manufacturer installation instructions. Seal all exposed fasteners at ridge caps, flashings on roof.

 GUTTERING OBSERVATIONS- DAMAGE/DEFECTS NOTED- Gutter(s) are filled with debris. (Leaves, sticks, and/or aggregate.) Debris may have restricted full viewing at some areas.

- D. Roof Structure and Attic** (if the attic is inaccessible, report the method used to inspect.)
Comments
 ACCESS METHOD/LIMITATIONS- Full access
 ATTIC OBSERVATIONS- Truss framing
 ROOF STRUCTURE OBSERVATIONS- No problems observed during this inspection period.

I=Inspected				NI=Not Inspected	NP=Not Present	R=Not Functioning or in Need of Repair	Inspection Item
I	NI	NP	R				

INSULATION OBSERVATIONS- A combination of fiberglass (and/or rock wool) batt type and blown in insulation were present.
 The insulation layer is approximately 7 - 10 inches thick.

-

E. Walls (Interior and Exterior)
Comments

INTERIOR WALL OBSERVATIONS- INTERIOR WALLS ARE COVERED WITH THE FOLLOWING MATERIAL(S)- Drywall.
 OBSERVATIONS- master bedroom hole in wall
 Cracking at side door interior corners
 Holes at living area wall
 Moisture damage, staining at interior of side door from leakage

EXTERIOR WALL OBSERVATIONS- EXTERIOR WALLS ARE CONSTRUCTED OF THE FOLLOWING MATERIALS- Aluminum/vinyl siding. Brick and/or block (stone) veneer over wood framing.
 Cement Fiber type siding. Soffit(s), eave(s), and/or trim are painted wood.
 OBSERVATIONS-water damage at left door trim
 Excessive spacing, missing weep holes at base of masonry siding. Add every 33"

-

F. Ceilings and Floors
Comments

CEILING COVERING(S)- CEILING OBSERVATIONS- ceiling damaged at front entry

-

G. Doors (Interior and Exterior)
Comments

INTERIOR DOOR OBSERVATIONS- No problems observed during this inspection period.

EXTERIOR DOOR OBSERVATIONS- Moisture related deterioration is present in door(s) and/or related trim in the following area(s). ---side door. Repair damage, reseal exterior and consider cover to protect from elements.

-

H. Windows
Comments

OBSERVATIONS- cracked glass at rear right bedroom window.

note: all windows must be kept sealed on exterior to prevent leakage

-

I. Fireplace/Chimney
Comments

I=Inspected				NI=Not Inspected				NP=Not Present				R=Not Functioning or in Need of Repair			
I	NI	NP	R	Inspection Item											

Not Present

- J. Porches, Decks and Carports (Attached)
Comments

PORCH OBSERVATIONS- No problems observed during inspection period.

- K. Other
Comments

Not Present

II. ELECTRICAL SYSTEMS

- A. Service Entrance and Panels
Comments:

SERVICE COMMENTS: Under Ground
MAIN PANEL COMMENTS: LOCATION- Exterior of house at left of house
PREDOMINANT OVERLOAD PROTECTION DEVICES- Circuit breakers are provided.
MAIN ELECTRICAL PANEL OBSERVATIONS- white wire used as hot leg of panel but not properly marked

SUB-PANEL COMMENTS: LOCATION- Garage
SUB-ELECTRICAL PANEL OBSERVATIONS- No problem(s) noted at the time of inspection.

- B. Branch Circuits - Connected Devices and Fixtures (Report as in need of repair the lack of ground fault circuit protection where required.);
Comments:

FEEDERS- Copper, Aluminum (220 volt OK)
VISIBLE BRANCH WIRING TYPE- Grounded type branch wiring present Copper
BRANCH WIRING OBSERVATIONS- RECEPTACLE DEFICIENCIES- light out at master bath

III. HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS

- A. Heating Equipment #1:
Type/Energy Source System Type- Electric Forced Air Heat Pump.
Comments:

Unit located at hall closet.
Heating System- The heating system operated correctly at the time of the inspection.

- B. Cooling Equipment #1:
Type/Energy Source. Electric.
Comments:

I=Inspected				NI=Not Inspected	NP=Not Present	R=Not Functioning or In Need of Repair	Inspection Item
I	NI	NP	R				

Cooling System- - Central, - Split System.
 1 rane est 2 1/2 ton 2000 unit located at exterior.
 AIR TEMPERATURE DIFFERENTIAL- Air Temperature Deficiencies- Temperature drop/differential observed to be over 20 degrees. This may indicate dirty evaporator coils, dirty air filter, or air flow restriction. Contact a licensed service company for further evaluation and/or cleaning.
 EVAPORATOR OBSERVATIONS-interior blower and coils in need of cleaning/ servicing.
 Debris and (fungal) type growth observed at interior blower unit in need of proper removal.
 CONDENSER (EXTERIOR UNIT) OBSERVATIONS-replace insulation on refrigerant lines to unit
 Exterior unit unlevel in need of repairs

-

C. Ducts and Vents
Comments

DUCTWORK TYPE- Fiberglass duct board and/or flexible type ducts were primarily used for distribution/return system throughout.
 Ductwork, Air Chase and/or Plenum Observations-all duct joints in need of sealing to prevent leakage
 It is not recommended to install cord or outlet for water heater in return chase.
 FILTER OBSERVATIONS- Filters are very dirty.

IV. PLUMBING SYSTEM

-

A. Water Supply System and Fixtures
Comments:

The potable water supply source is- Municipal service is primary water source.
 SUPPLY PIPING TYPE- Copper, Galvanized
 POTABLE WATER LINE OBSERVATIONS- Appears serviceable.
 EXTERIOR PLUMBING-hose bibbs leaking at handles when on

-

Bathroom #1 MASTER BATHROOM:

LAVATORY- aerator stopped up at faucet
 TOILET/BIDET PLUMBING- No problems observed during this inspection period.
 TUB/SHOWER PLUMBING- shower head leaking at wall.

-

Bathroom #2

I=Inspected		NI=Not Inspected		NP=Not Present	R=Not Functioning or in Need of Repair	Inspection Item
I	NI	NP	R			

B. Drains, Wastes, Vents
Comments:
 DRAIN/WASTE & VENT PIPING TYPE- PVC plastic
 SEWER PIPE OBSERVATIONS- No problems observed during this inspection period.

Bathroom #1 MASTER BATHROOM:
 LAVATORY- No problems observed during this inspection period
 TOILET/BIDET PLUMBING- No problems observed during this inspection period.
 TUB/SHOWER PLUMBING- No problems observed during this inspection period.

C. Water Heating Equipment #1: (Report as in need of repair those conditions specifically listed as recognized hazards by TREC rules.)
Energy Source: Electrically operated.
Comments:
 State 40 gallon unit located at hall closet
 No problems observed during this inspection period.

D. Hydro Therapy Equipment
Comments:
 Not Present

V. APPLIANCES

A. Dishwasher
Comments:
 Unit is not properly secured in cabinet.

B. Food Waste Disposer
Comments:
 No problems observed during limited test run of appliance.

C. Range Hood
Comments:
 No problems observed during limited test run of appliance.

D. Ranges/Ovens/Cooktops
Comments:
 Oven present, Electric.
 One burner missing at unit

E. Microwave Cooking Equipment
Comments:

I=Inspected				NI=Not Inspected	NP=Not Present	R=Not Functioning or in Need of Repair	Inspection Item
I	NI	NP	R				

F. **Trash Compactor**
Comments:

Not Present

G. **Bathroom Exhaust Fans and/or Heaters**
Comments:

Not Present

Vent unit present. No problems observed during limited test run of appliance.

H. **Whole House Vacuum Systems**
Comments:

Not Present

I. **Garage Door Operators**
Comments:
 No problems observed during limited test run of appliance.

J. **Door Bell and Chimes**
Comments:
 No problems observed.

K. **Dryer Vents**
Comments:
 No problems noted.

L. **Other Built-in Appliances**
Comments:
 Not Present

VI. OPTIONAL SYSTEMS

A. **Lawn Sprinklers**
Comments:
 Not Present

B. **Swimming Pools and Equipment**
Comments:
 Not Present

C. **Outbuildings**
Comments:

I=Inspected				NI=Not Inspected	NP=Not Present	R=Not Functioning or in Need of Repair	Inspection Item
I	NI	NP	R				

Not Present

D. Outdoor Cooking Equipment
Energy Source:
Comments:

Not Present

E. Gas Lines
Comments:

Not Present

F. Water Wells (A coliform analysis is recommended)
Type of Pump:
Type of Storage Equipment:
Comments:

Not Present

G. Septic Systems
Comments:

Not Present

H. Security Systems
Comments:
 security testing is not part of this inspection

I. Fire Protection Equipment
Comments:

Not Present