

PROPERTY INSPECTION REPORT

Prepared For: SAHA

(Name of Client)

Concerning: 1702 Villa Placer San Antonio, TX 78237

(Address or Other Identification of Inspected Property)

By: Gary Armstrong 9604 02/26/08

(Name and License Number of Inspector) (Date)

(Name, License Number and Signature of Sponsoring Inspector, if required)

The inspection of the property listed above must be performed in compliance with the rules of the Texas Real Estate Commission (TREC).

The inspection is of conditions which are present and visible at the time of the inspection, and all of the equipment is operated in normal modes. The inspector must indicate which items are in need of repair or are not functioning and will report on all applicable items required by TREC rules.

This report is intended to provide you with information concerning the condition of the property at the time of inspection. Please read the report carefully. If any item is unclear, you should request the inspector to provide clarification.

It is recommended that you obtain as much history as is available concerning this property. This historical information may include copies of any seller's disclosures, previous inspection or engineering reports, reports performed for or by relocation companies, municipal inspection departments, lenders, insurers, and appraisers. You should attempt to determine whether repairs, renovation, remodeling, additions or other such activities have taken place at this property.

Property conditions change with time and use. Since this report is provided for the specific benefit of the client(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

ADDITIONAL INFORMATION PROVIDED BY INSPECTOR

Report Number: 20080242037 Phone Number: _____
Date of Inspection: 02/26/08 Fax Number: _____
Time of Inspection: _____
Client Mailing Address: _____
City/State/Zip: _____

SPECIAL NOTES:

Reinspection done 04/24/08. Notes are in report.

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair.

I=Inspected		NI=Not Inspected		NP=Not Present	R=Not Functioning or in Need of Repair	Inspection Item
I	NI	NP	R			

I. STRUCTURAL SYSTEMS

A. Foundations (If all crawl space areas are not inspected, provide an explanation.)
Comments (An opinion on performance is mandatory.):

FOUNDATION TYPE- Concrete slab on grade.
 CONCRETE FOUNDATION OBSERVATIONS- Foundation appears to be functioning normally at time of inspection.
 Minor signs of past settlement observed in the form of hair line type cracking to finished surfaces. Smaller, fracture cracks to finished floor in garage observed.

B. Grading and Drainage
Comments
 Structure is built on a slightly sloped lot. Grade at foundation appears inadequate at rear , near side door area. . Repair drainage at these areas to properly drain away from foundation, to prevent water accumulation and possible stress to structure.

C. Roof Covering (If the roof is inaccessible, report the method used to inspect.)
Comments
 METHOD USED TO INSPECT ROOF- The following was observed upon walking on the roof.
 DESCRIPTION OF MATERIALS- Composition and/or fiberglass shingles. Note: Average life expectancy under normal installation/conditions is between 10 -14 years. Approximate age of roof. Approximate age of this roof covering is believed to be between 5 and 10 years old.
 ROOF COVERING OBSERVATIONS- Seal all exposed fasteners at ridge caps, flashings on roof.
 Starter strip around perimeter edge of roof improperly installed, not sealed down as per manufacturer installation instructions.
 Tree limb(s) observed in contact and rubbing surface of roof. Trim to avoid excessive wear.
 GUTTERING OBSERVATIONS- DAMAGE/DEFECTS NOTED- Downspouts terminate near the foundation. All gutter downspouts should have splash blocks or diverters to control erosion.

D. Roof Structure and Attic (If the attic is inaccessible, report the method used to inspect.)
Comments
 ACCESS METHOD/LIMITATIONS- Full access
 ATTIC OBSERVATIONS- Truss framing
 ROOF STRUCTURE OBSERVATIONS- No problems observed during this inspection

I=Inspected		NI=Not Inspected		NP=Not Present	R=Not Functioning or in Need of Repair	Inspection Item
I	NI	NP	R			

period.
 INSULATION OBSERVATIONS- Blown type insulation (either fiberglass or rock wool) present. The insulation layer is approximately, 8 to 10 inches thick.

E. Walls (Interior and Exterior)

Comments

INTERIOR WALL OBSERVATIONS- INTERIOR WALLS ARE COVERED WITH THE FOLLOWING MATERIAL(S)- Drywall.

OBSERVATIONS- No problems observed during this inspection period.

OBSERVATIONS- moisture damage at rear door area interior

EXTERIOR WALL OBSERVATIONS- EXTERIOR WALLS ARE CONSTRUCTED OF THE FOLLOWING MATERIALS- Brick and/or block (stone) veneer over wood framing.

Cement Fiber type siding. Soffit(s), eave(s), and/or trim are painted wood

OBSERVATIONS- Excessive spacing, missing weep holes in masonry siding. Add every 33"

Soffit damaged at left front eave **Repaired 04/24/08.**

Reseal lap siding joints on exterior

F. Ceilings and Floors

Comments

CEILING COVERING(S)- CEILING OBSERVATIONS- No problems observed during this inspection period.

G. Doors (Interior and Exterior)

Comments

INTERIOR DOOR OBSERVATIONS- No problems observed during this inspection period.

EXTERIOR DOOR OBSERVATIONS- Moisture related deterioration is present in door(s) and/or related trim in the following area(s). --- rear door . Repair damage, reseal exterior and consider cover to protect from elements.

Add spring at garage overhead door. **Repaired 04/24/08.**

H. Windows

Comments

OBSERVATIONS- springs out, windows not properly supported at upper right front bedroom **Repaired 04/24/08.**

I. Fireplace/Chimney

Comments

Not Present

I=Inspected		NI=Not Inspected		NP=Not Present	R=Not Functioning or in Need of Repair	Inspection Item
I	NI	NP	R			

J. Porches, Decks and Carports (Attached)
Comments

PORCH OBSERVATIONS- No problems observed during inspection period.

K. Other
Comments

Not Present

II. ELECTRICAL SYSTEMS

A. Service Entrance and Panels
Comments:

SERVICE COMMENTS: Under Ground

MAIN PANEL COMMENTS: LOCATION- Exterior of house at right side.

PREDOMINANT OVERLOAD PROTECTION DEVICES- Circuit breakers are provided.

MAIN ELECTRICAL PANEL OBSERVATIONS- white wires used as hot legs in panel but not properly marked as hot legs. **Repaired 04/24/08.**

SUB-PANEL COMMENTS: LOCATION- Garage

SUB-ELECTRICAL PANEL OBSERVATIONS- No problem(s) noted at the time of inspection.

B. Branch Circuits - Connected Devices and Fixtures (Report as in need of repair the lack of ground fault circuit protection where required.):
Comments:

FEEDERS- Copper, Aluminum (220 volt OK)

VISIBLE BRANCH WIRING TYPE- Grounded type branch wiring present. Copper

BRANCH WIRING OBSERVATIONS, LIGHTING & CEILING FAN DEFICIENCIES- lights missing at front porch

RECEPTACLE DEFICIENCIES-outlet damaged at front left bedroom, not functional.

Repaired 04/24/08.

III. HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS

A. Heating Equipment #1:
Type/Energy Source: System Type- Electric Forced Air Heat Pump.
Comments:

Unit located at hall closet.

Heating System- The heating system operated correctly at the time of the inspection.

B. Cooling Equipment #1:
Type/Energy Source: Electric.
Comments:

I=Inspected		NI=Not Inspected		NP=Not Present	R=Not Functioning or in Need of Repair
I	NI	NP	R	Inspection Item	

Cooling System- - Central, - Split System.
 Trane est 3 ton 2000 unit located at exterior
 AIR TEMPERATURE DIFFERENTIAL- Temperature drop/differential observed between 15 - 20 degrees. (taken between interior return and supply air) This is considered a normal operating range.
 EVAPORATOR OBSERVATIONS-debris and fungal type growth observed at interior blower, coils in need of professional cleaning/removal **Not Repaired 04/24/08.**
 CONDENSER (EXTERIOR UNIT) OBSERVATIONS-replace insulation on lines to exterior unit.

-
-
-
-

C. Ducts and Vents

Comments:

DUCTWORK TYPE- Fiberglass duct board and/or flexible type ducts were primarily used for distribution/return system throughout.

Ductwork, Air Chase and/or Plenum Observations- **Openings observed at ducts and/or at blower unit allowing air to escape from the system.** Seal all joints throughout attic. **Not Repaired 04/24/08.**

Left front bedroom vent loose at ceiling **Repaired 04/24/08.**

IV. PLUMBING SYSTEM

-
-
-
-

A. Water Supply System and Fixtures

Comments:

The potable water supply source is- Municipal service is primary water source.

SUPPLY PIPING TYPE- Copper, Galvanized

POTABLE WATER LINE OBSERVATIONS- Appears serviceable.

-
-
-
-

Bathroom #1 MASTER BATHROOM:

LAVATORY- No problems observed during this inspection period.

TOILET/BIDET PLUMBING- **flush valve in tank in need of replacement. Repaired 04/24/08.**

TUB/SHOWER PLUMBING- No problems observed during this inspection period.

-
-
-
-

Bathroom #2 HALL BATHROOM: SECOND FLOOR.

LAVATORY-slow drain observed at sink

TOILET/BIDET PLUMBING- No problems observed during this inspection period.

TUB/SHOWER PLUMBING- No problems observed during this inspection period.

-
-
-
-

B. Drains, Wastes, Vents

Comments:

I=Inspected		NI=Not Inspected		NP=Not Present	R=Not Functioning or in Need of Repair	Inspection Item
I	NI	NP	R			

DRAIN/WASTE & VENT PIPING TYPE- PVC plastic
 SEWER PIPE OBSERVATIONS- No problems observed during this inspection period.

Bathroom #1 MASTER BATHROOM:

LAVATORY- No problems observed during this inspection period.
 TOILET/BIDET PLUMBING- No problems observed during this inspection period.
 TUB/SHOWER PLUMBING- No problems observed during this inspection period.

Bathroom #2 HALL BATHROOM: SECOND FLOOR.

LAVATORY- No problems observed during this inspection period.
 TOILET/BIDET PLUMBING- No problems observed during this inspection period.
 TUB/SHOWER PLUMBING- No problems observed during this inspection period.

C. Water Heating Equipment #1: (Report as in need of repair those conditions specifically listed as recognized hazards by TREC rules.)
Energy Source: Electrically operated.
Comments:

State 40 gallon 2000 unit located at closet.
 No problems observed during this inspection period.

D. Hydro Therapy Equipment
Comments:

Not Present

V. APPLIANCES

A. Dishwasher
Comments:

Discharge hose is, **installed without an air gap.** The drain line should be raised to the underside of the counter top.

B. Food Waste Disposer
Comments:

Deficiencies- Noise and or vibration was present when operated.

C. Range Hood
Comments:

Light failed to operate.

I=Inspected		NI=Not Inspected		NP=Not Present	R=Not Functioning or in Need of Repair	Inspection Item
I	NI	NP	R			
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>			D. Ranges/Ovens/Cooktops <i>Comments:</i> Oven present, Electric. Free standing range is not properly secured in place to prevent accidental tip over. Unit should be secured with wall or floor brackets as a safety precaution.
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>			E. Microwave Cooking Equipment <i>Comments:</i> Not Present
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>			F. Trash Compactor <i>Comments:</i> Not Present
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>			G. Bathroom Exhaust Fans and/or Heaters <i>Comments:</i> Vent unit present. No problems observed during limited test run of appliance.
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>			H. Whole House Vacuum Systems <i>Comments:</i> Not Present
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>			I. Garage Door Operators <i>Comments:</i> Not Present
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>			J. Door Bell and Chimes <i>Comments:</i> No problems observed.
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>			K. Dryer Vents <i>Comments:</i> No problems noted.
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>			L. Other Built-in Appliances <i>Comments:</i> Not Present

VI. OPTIONAL SYSTEMS

<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>			A. Lawn Sprinklers <i>Comments:</i>
--------------------------	--------------------------	-------------------------------------	--------------------------	--	--	---

I=Inspected		NI=Not Inspected		NP=Not Present	R=Not Functioning or in Need of Repair	Inspection Item
I	NI	NP	R			

Not Present

B. Swimming Pools and Equipment
Comments:

Not Present

C. Outbuildings
Comments:

Not Present

D. Outdoor Cooking Equipment
Energy Source:
Comments:

Not Present

E. Gas Lines
Comments:

Not Present

F. Water Wells (A coliform analysis is recommended.)
Type of Pump:
Type of Storage Equipment:
Comments:

Not Present

G. Septic Systems
Comments:

Not Present

H. Security Systems
Comments:

security testing is not part of this inspection

I. Fire Protection Equipment
Comments:

Not Present